



DO THE JOB RIGHT.®

Item #20279

MIG250 WELDER

SERVICE MANUAL



STATEMENT OF LIMITED WARRANTY

The Eastwood Company (hereinafter "Eastwood") warrants to the end user (purchaser) of all new welding and cutting equipment (collectively called the "products") that it will be free of defects in workmanship and material. This warranty is void if the equipment has been subjected to improper installation, improper care or abnormal operations.

WARRANTY PERIOD:

All warranty periods begin on the date of purchase from Eastwood. Warranty Periods are listed below, along with the products covered during those warranty periods:

3 Year Warranty on Material, Workmanship, and Defects:

- Eastwood MIG250 Welder

Items not covered under this warranty: Contact tips, nozzles, wire, and ground clamp and cable.

All other components are covered by the warranty and will be repaired or replaced at the discretion of Eastwood.

2 Years:

- All Welding Helmets.

CONDITIONS OF WARRANTY TO OBTAIN WARRANTY COVERAGE:

Purchaser must first contact Eastwood at 1-800-345-1178 for an RMA# before Eastwood will accept any welder returns.

Final determination of warranty on welding and cutting equipment will be made by Eastwood.

WARRANTY REPAIR:

If Eastwood confirms the existence of a defect covered under this warranty plan, Eastwood will determine whether repair or replacement is the most suitable option to rectify the defect. At Eastwood's request, the purchaser must return, to Eastwood, any products claimed defective under Eastwood's warranty.

FREIGHT COSTS:

The purchaser is responsible for shipment to and from Eastwood.

WARRANTY LIMITATIONS:

EASTWOOD WILL NOT ACCEPT RESPONSIBILITY OR LIABILITY FOR REPAIRS UNLESS MADE BY EASTWOOD. EASTWOOD'S LIABILITY UNDER THIS WARRANTY SHALL NOT EXCEED THE COST OF CORRECTING THE DEFECT OF THE EASTWOOD PRODUCT. EASTWOOD WILL NOT BE LIABLE FOR INCIDENTAL OR CONSEQUENTIAL DAMAGES (SUCH AS LOSS OF BUSINESS, ETC.) CAUSED BY THE DEFECT OR THE TIME INVOLVED TO CORRECT THE DEFECT. THIS WRITTEN WARRANTY IS THE ONLY EXPRESS WARRANTY PROVIDED BY EASTWOOD WITH RESPECT TO ITS PRODUCTS. WARRANTIES IMPLIED BY LAW SUCH AS THE WARRANTY OF MERCHANTABILITY ARE LIMITED TO THE DURATION OF THIS LIMITED WARRANTY FOR THE EQUIPMENT INVOLVED. THIS WARRANTY GIVES THE PURCHASER SPECIFIC LEGAL RIGHTS. THE PURCHASER MAY ALSO HAVE OTHER RIGHTS WHICH VARY FROM STATE TO STATE.

SPECIFICATIONS

POWER SUPPLY

Rated Power Output		No Load Voltage	Power Input at Rated Output		Duty Cycle		Overall Dimension	Weight
240 VAC	120 VAC		240 VAC	120 VAC	240 VAC	120 VAC		
30-250 A	30-140 A	61V	47.3 A	20 A	60% @ 250 A	60% @ 140 A	30" x 15" x 19.3"	76 lbs.

WELDING WIRE


Wire Type	Solid Steel	Stainless Steel	Flux Cored	Aluminum
Diameter	.023 - .045" (0.6 - 1.2mm)	.023 - .045" (0.6 - 1.2mm)	.030 - .045" (0.8 - 1.2mm)	.030 - .035" (0.8 - .9mm)*

* Wire sizes are for use with the Spool Gun, other sizes may be used with the standard torch and a Teflon Liner.

When opening your Eastwood MIG 250, check to make sure all of the parts listed below are included:

- | | | |
|-----------------------------|---|------------------------------|
| (1) MIG 250 Welder | (1) Shielding Gas Hose | (1) 120/240 VAC Adapter Cord |
| (1) MIG Gun | (1) Extra Contact Tips (2) .030" | (1) Drive Roller |
| (1) Ground Cable with Clamp | (1) 8" Wire Spool Adapter | (1) Instruction Manual |
| (1) Shielding Gas Regulator | (1) Steel MIG Wire, ER70S-6, 2lb., 0.030" | |

SAFETY INFORMATION

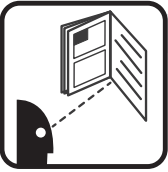

READ INSTRUCTIONS!

- Thoroughly read and understand this instruction manual before using the welder.



ELECTRIC SHOCK CAN KILL!

- Improper use of an electric welder can cause electric shock, injury and death! Read all precautions described in this manual to reduce the possibility of electric shock.
- Do not touch any electrical components that may be live.
- Separate yourself from the welding circuit by using insulating mats to prevent contact from the work surface.
- The welder power switch is to be in the OFF position and the power supply is to be disconnected when performing any maintenance or consumable changes.
- **Always wear dry, protective clothing and leather welding gloves and insulated footwear.**
- Always operate the welder in a clean, dry, well ventilated area. Do not operate the welder in humid, wet, rainy or poorly ventilated areas.
- Be sure that the work piece is properly supported and grounded prior to beginning an electric welding operation.
- The electrode and work (or ground) circuits are electrically “hot” when the welder is on. Do not touch these “hot” parts with your bare skin or wet clothing.
- **Disconnect from power supply before assembly, disassembly or maintenance of the torch or contact tip or changing wire spools.**
- Always attach the ground clamp to the piece to be welded and as close to the weld area as possible. This will give the least resistance and best weld.



FUMES AND WELDING GASES CAN BE DANGEROUS!

- Do not breathe fumes that are produced by the welding operation. These fumes are dangerous. Keep your head and face out of welding fumes. Do not breathe the welding fumes
- Always work in a properly ventilated area. Wearing an OSHA-approved respirator when welding is recommended!
- Never weld coated materials including but not limited to: cadmium plated, galvanized, lead based paints.
- Refer to the MSDS (Material Safety Data Sheet) for any consumables or materials used during welding for additional safety instructions.



WELDING SPARKS CAN CAUSE FIRE OR EXPLOSION!

- Do not operate electric arc welder in areas where flammable or explosive vapors are present.
- Always keep a fire extinguisher nearby while welding.
- Use welding blankets to protect painted surfaces, dash boards, engines, etc.
- Ensure power supply has properly rated wiring to handle power usage.
- Do not use on or near combustible surfaces.
- Remove all flammable items within 35 feet of the welding area.
- Do not weld frozen pipes.

SAFETY INFORMATION



ARC RAYS CAN BURN!

- Use a shield with the proper filter (a minimum of #11) to protect your eyes from sparks and the rays of the arc when welding or when observing open arc welding (see ANSI Z49.1 and Z87.1 for safety standards).
- Use suitable clothing made from durable flame-resistant material to protect your skin. Protect nearby individuals with a non-flammable barrier.
- Wear safety glasses under your welding helmet with side shields.
- If other persons are in the area of welding use welding screens to protect bystanders from sparks and arc rays.



HOT METAL WILL BURN!

- Electric welding operations cause sparks and heat metal to temperatures that will cause severe burns!
- Use protective gloves and clothing when performing any welding operations. Always wear long pants, long-sleeved shirts and leather welding gloves.
- Make sure that all persons in the welding area are protected from heat, sparks and ultraviolet rays. Use additional face shields and flame resistant barriers as needed.
- Never touch work piece until it has completely cooled.



ELECTROMAGNETIC FIELDS MAY BE DANGEROUS!

- The electromagnetic field that is generated during arc welding may interfere with various electrical and electronic devices such as cardiac pacemakers. Anyone using such devices should consult with their physician prior to performing any electric welding operations.
- Exposure to electromagnetic fields while welding may have other health effects which are not known.



WELDING WIRE CAN BE DANGEROUS!

- Never point the welding gun at any part of the body, other people, or metal surfaces.
- Wear safety glasses and handle welding wire safety as it can be sharp and cause injury.



MOVING PARTS CAN BE DANGEROUS!

- Use care when working near the drive motor assembly as it can pinch.
- Do not put fingers or other body parts between moving parts.



FLYING METAL CHIPS CAN CAUSE INJURY!

- Welding, brushing, hammering, chipping, and grinding can cause flying metal chips and sparks.
- To prevent injury wear approved safety glasses.



MAGNETIC FIELDS CAN AFFECT PACEMAKERS!

- Any user with a pacemaker should consult their doctor before use.
- Anyone with a pacemaker should stay away from any electric welding before consulting a doctor.






NOTICE!

- Do not touch the contact tip with the unit turned "ON". Turn the unit "OFF" before changing tips or cleaning the nozzle.

COMPONENTS & CONTROLS


1. Ground Cable Connection
2. MIG/Spool Gun Connection
3. MIG/Spool Gun Switch Connection
4. Power Switch
5. Voltage Control
6. Wire Speed Control
7. MIG/Spool Gun Selector Switch
8. Shielding Gas Regulator
9. Shielding Gas Hose
10. Shielding Gas Input
11. Nozzle
12. Contact Tip
13. Wire Pressure Adjuster
14. Rocker Arm
15. Drive Roller
16. Drive Roller Retaining Knob
17. Welding Gun Tensioner
18. Positive Terminal
19. Negative Terminal
20. Wire Spool Tension Screw
21. 8" Wire Spool Adapter
22. MIG Gun
23. 120 to 240 VAC Adaptor Cord
24. Quick Feed Switch

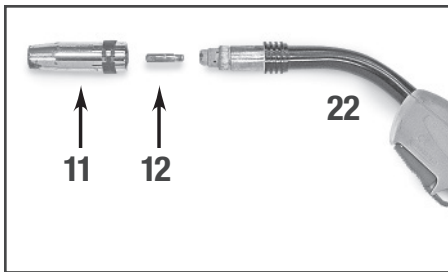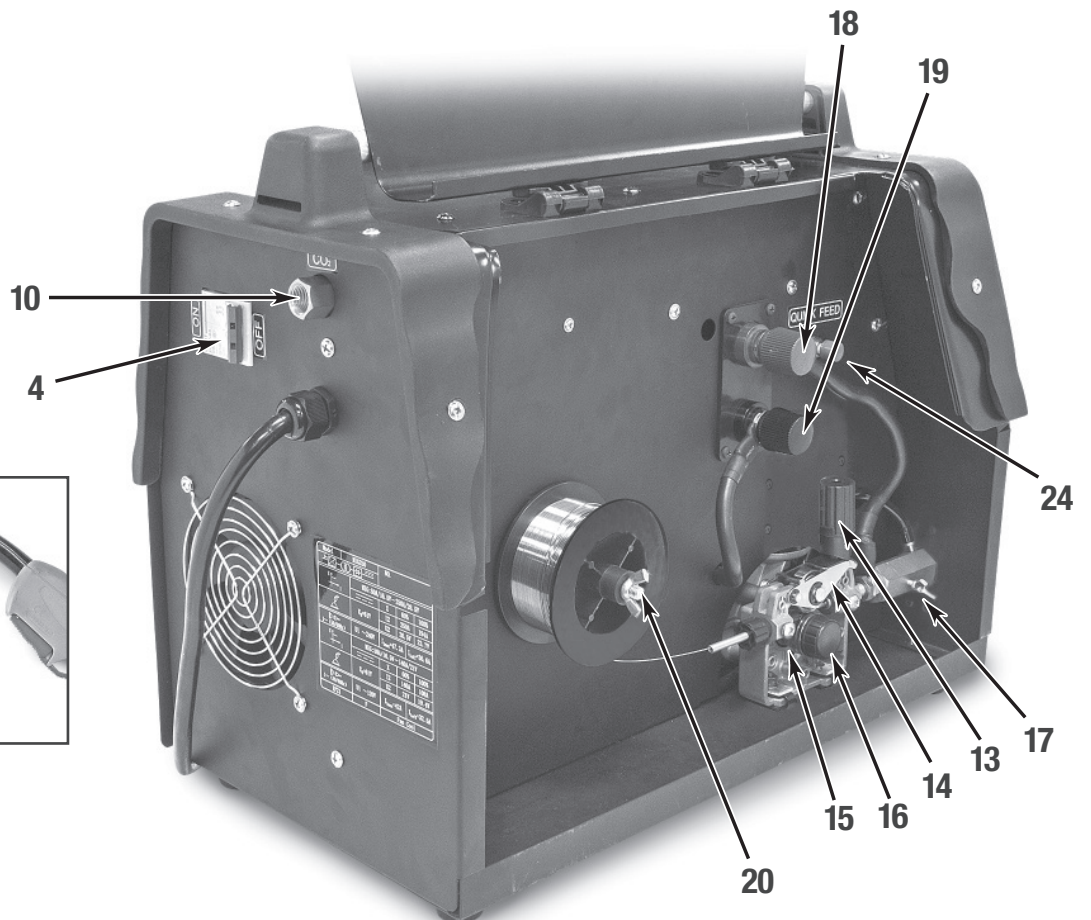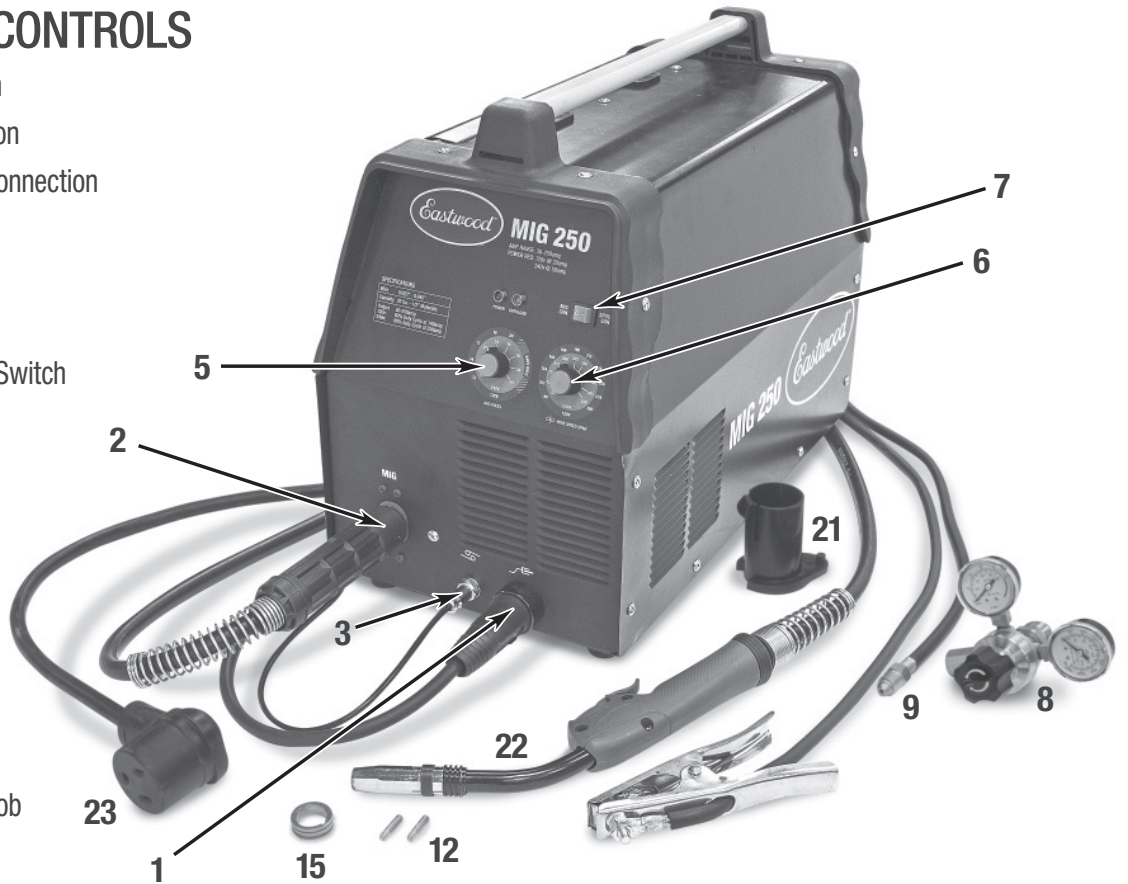

CONNECTING THE WELDER TO A POWER SOURCE

For use on 240 VAC power, the Eastwood MIG 250 Welder requires a dedicated 240 VAC, 50 Amp, 50-60Hz grounded outlet protected by a circuit breaker with a NEMA 6-50 Receptacle. If using an extension cord, use a minimum 6 AWG cord for up to 25 feet.

For use on 120 VAC power, the Eastwood MIG 250 Welder requires a dedicated 120 VAC, 20 Amp, 50-60Hz grounded outlet protected by a circuit breaker. If using an extension cord, use a minimum 12 AWG cord for up to 25 feet. When using the welder on 120 VAC input power, do not turn the voltage setting past the indicated marking, or the amperage draw will exceed 20 Amps, which will trip a circuit breaker.


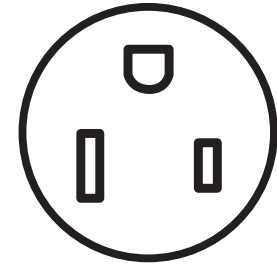


6-50 Receptacle

SET UP & OPERATION

INSTALLING THE WELDING GUN

1. Open the side door of the welder and loosen the Welding Gun Tensioner Thumb Screw (**Fig. A**).
2. Slide the brass body of the Welding Gun through the front of the Welder into the Welding Gun Power Connection. Insert until it bottoms against the Drive Motor Assembly or a gas leak may occur.
3. Tighten the Welding Gun Tensioner Security.
4. Connect the Trigger Plug on the Welding Gun to the Trigger Plug Connection on the Welder (**Fig. B**).
5. Set the MIG/Spool Gun Selector Switch to MIG.

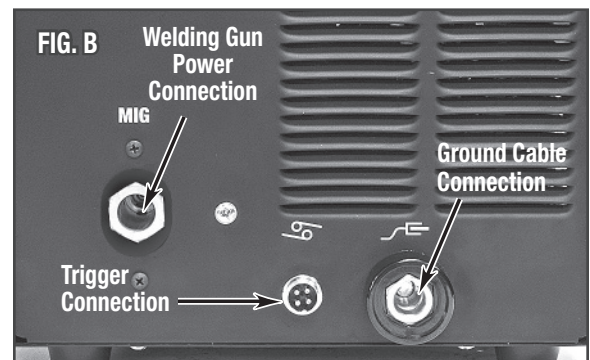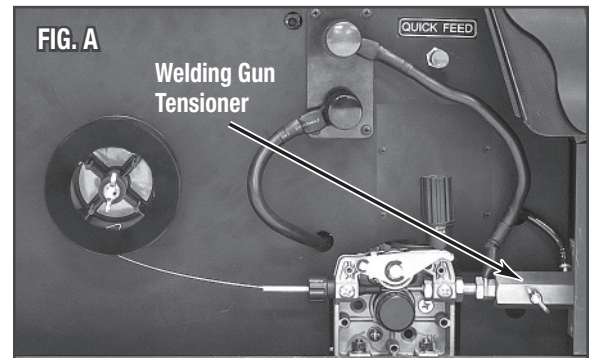

INSTALLING THE GROUND CLAMP


1. Locate the Ground Cable and Clamp.
2. The Ground Cable Connection is located at the far right of the Front Panel. With the Key on the Connector in the 12 O'clock position, insert the Connector and turn 180° clockwise to lock in the Connector (**Fig. B**).

CHANGING POLARITY (FLUX CORE WIRE)

UNPLUG UNIT FIRST!

The Eastwood MIG 250 comes set up to MIG weld with solid wire. To weld without gas using flux-cored wire, the polarity must be changed.

1. Turn OFF and disconnect welder from power.
2. Remove the knobs on the Negative and Positive Power Terminals (**Fig. C**).
3. Remove the power leads from the studs.
4. Install the Positive lead from the Torch onto the Negative (-) Stud and replace the Black knob (**Fig. D**).
5. Install the Negative lead from the Ground Cable onto the Positive (+) Stud and replace the Red knob (**Fig. D**).

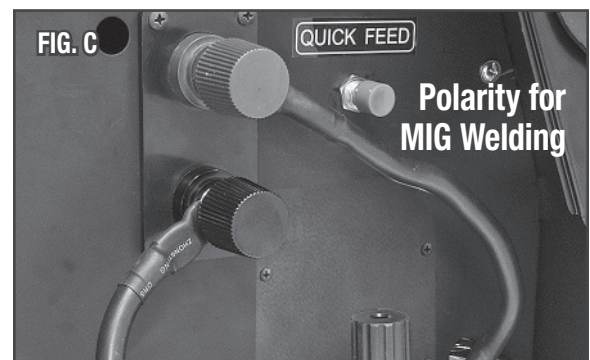


INSTALLING SHIELDING GAS SUPPLY

A shielding Gas bottle is not included with your Eastwood MIG 250 but is necessary for welding using solid wire. Eastwood recommends the following shielding gases or consult your wire manufacturer for their recommendations:

Wire Type	Shielding Gas
Steel (short circuit)	75% Argon / 25% CO ²
Stainless Steel	90% He / 7.5% Ar / 2.5% CO ² (Tri-Mix)
Aluminum	100% Argon

1. Place the MIG 250 in its dedicated area or on a welding cart.
2. Secure your shielding gas bottle to a stationary object or mount to your welding cart.
3. Remove the cap from the shielding gas bottle.
4. Insert the large brass male fitting on the Shielding Gas Regulator onto to female fitting on the shielding gas bottle. **NOTE:** Do not use white Teflon tape on this connection as it is a compression fitting and does not require it. If you have leaks, check the tank and regulator fitting for dirt or burrs.
5. Tighten the fitting with a wrench until snug, do not over tighten.
6. Connect either end of the gas line to the fitting on the rear of the MIG 250 and wrench tighten until snug (**Fig. E**).
7. Check the gas line for leaks by slowly opening the valve on the gas bottle. When welding, the valve on the bottle should be open all of the way.

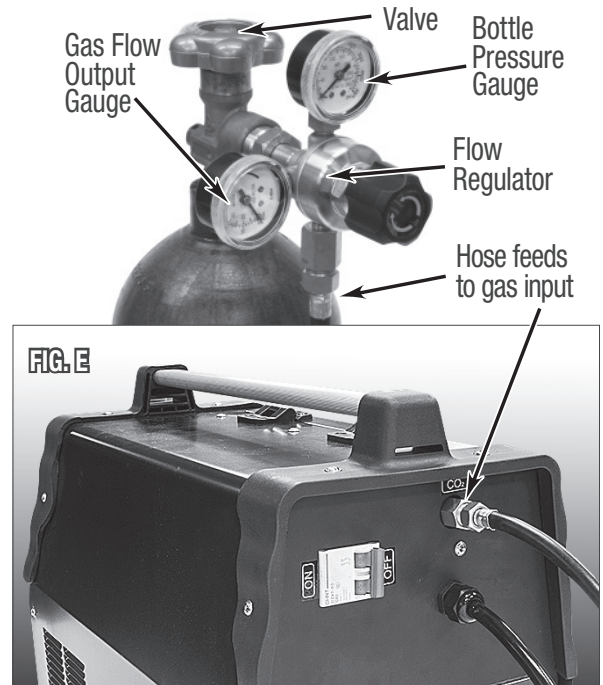


CHANGING THE DRIVE ROLLER

The MIG 250 is set up to use 0.030" (0.8mm) wire. If a different size wire is used, the drive roller needs to be changed. Adjust the drive roller according to the following procedure:

UNPLUG UNIT FIRST!

1. Open the side door of the welder to access the drive motor (**Fig. F**).
2. Lift the Pressure Adjuster out of the way and move the Tension Arm away from the Drive Roller.
3. Remove the Drive Roller Retaining Knob by turning the knob counterclockwise.
4. Remove the Drive Roller by sliding the outer drive roller ring off the drive roller hub.
5. Install the drive roller in the orientation so that the size of the wire you are using is facing you on the side of the drive roller.
6. Reinstall the Drive Roller Retaining Knob and finger tighten.
7. Put the Tension Arm back in place and reset the Pressure Adjuster.

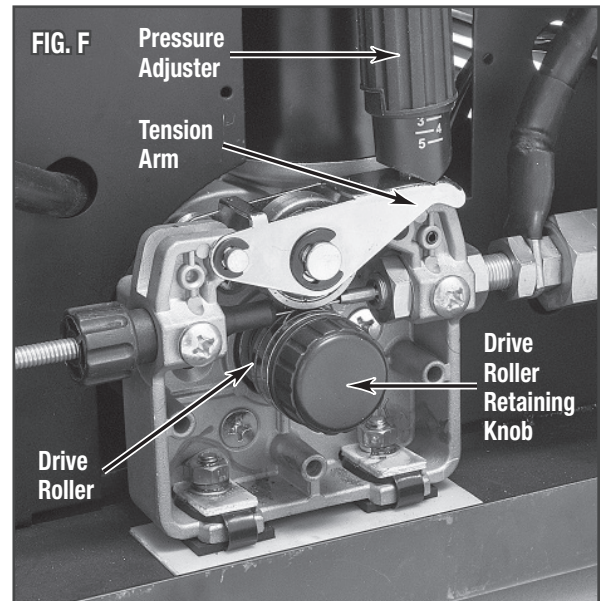

INSTALLING WELDING WIRE



The MIG 250 can be used with either a 4" or 8" Wire Spool. To use the larger 8" spool an included adapter is necessary.

To install a 4" Wire Spool:

1. Open the door of the welder and remove the wing nut, spacer and 8" Spool Adapter from the wire Spool Spindle.
2. Slide the 4" Wire Spool onto the spindle and reinstall the spacer and wing nut (**Fig. G**). Place the Spool Adapter in a safe place for if it is needed in the future.
3. To set the tension on the wire, tighten the wing nut till there is a slight resistant to spinning the wire spool. If the tension is set too loose the wire spool will spin on the shaft and un-spool the wire. If the tension is too tight, the drive roller will have issues pulling the wire and feeding issues will occur.


To install an 8" Wire Spool:

1. Open the door of the welder and be sure the 8" spool adapter is installed on the spindle. If it has been previously removed, reinstall it (**Fig. H**).
2. Align the pin on the spool adapter with the hole on the wire spool and slide the spool over the adapter making sure the pin on the adapter goes into the hole in the spool.
3. To set the tension on the wire, tighten the wing nut until there is a slight resistance to spinning the wire spool on the spindle. If the tension is set too loose the wire spool will spin on the shaft and un-spool the wire. If the tension is too tight, the drive roller will have issues pulling the wire and feeding issues will occur.

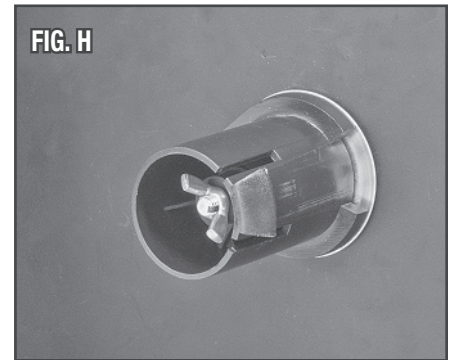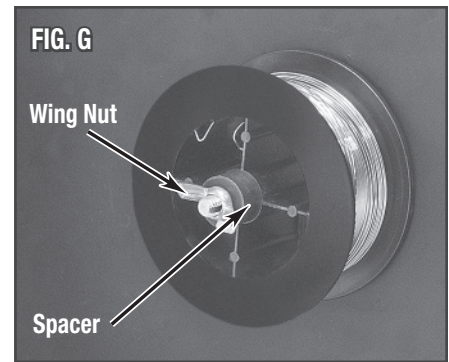

FEEDING WELDING WIRE

1. Turn Power Switch off and disconnect welder from power supply.
2. Unlock the Pressure Adjuster on the Wire Tensioner by pushing it towards the front of the welder.
3. Lift up the Rocker Arm so that it is out of the way.
4. Ensure that the Drive Roller size is appropriate to the welding wire size; see page 7 on how to change the Drive Roller.
5. Pull out the welding wire from the welding wire spool carefully.
NOTE: DO NOT LET GO OF THE WIRE PRIOR TO STEP 5 OR THE SPOOL WILL UNRAVEL RENDERING IT USELESS.
6. Cut off the small piece of the curved segment at the front of welding wire and straighten the welding wire approximately 3.0" long.
7. Thread the welding wire through the guide pipe and over the wire feed roller and into the torch hole.
8. Reattach the rocker arm and reset the Pressure Adjuster on the wire feeder.
9. Remove the contact tip and nozzle from the MIG Gun.
10. Turn on the machine.
11. With the gun pointed away from you and others, depress the Quick Feed button to feed the wire through the gun cable. Stop feeding the wire once the wire has come a few inches out of the end of the MIG Gun. **NOTE:** Watch the drive roller to see if any slipping is occurring between the roller and the wire – if so turn the machine off and tighten the Pressure Adjuster 1/2 turn and test again.

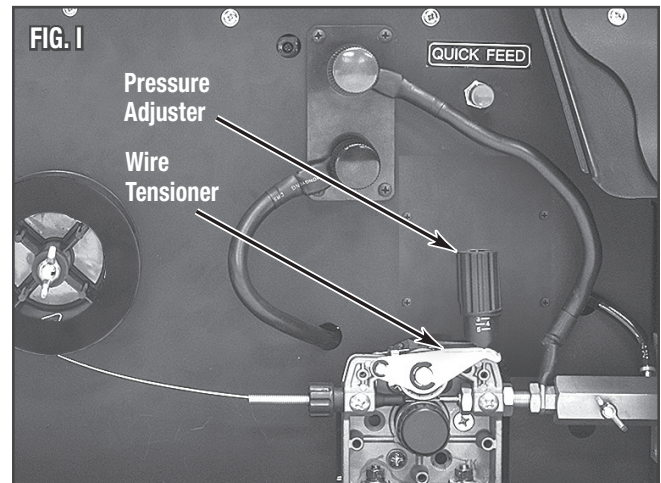


INSTALLING A SPOOL GUN (SOLD SEPARATELY)

1. Turn off welder and unplug from power source.
2. Switch the selector switch to the Spool Gun position.
3. Open the side door of the welder and loosen the Torch Tensioner.
4. If the standard welding gun is installed remove it and its associated connector.
5. Slide the brass body of the Spool Gun in through the front of the unit in the designated socket. Be sure to insert until it bottoms against the drive assembly or a gas leak may occur.
6. Connect Gun Trigger metal plug on the front of the welder.
7. Tighten the Torch Tensioner finger tight.



INSTALLING & FEEDING WELDING WIRE WITH A SPOOL GUN

1. Turn off welder and unplug from power source.
2. Set the switch above the drive motor to the spool gun setting.
3. Remove the thumb screw and clear plastic wire spool cover.
4. Remove the thumb screw and spring Tensioner that holds the wire spool on.
5. Place wire spool on spindle and replace the thumb screw with spring Tensioner and tighten till the point that the spool has some tension on it.
6. Loosen the Brass Tensioner Thumb Screw until it is possible to feed the welding wire through the drive roller grooves.
7. Feed the wire by hand from the spool into the inlet guide, past the drive rollers and into the wire inlet.
8. Tighten the Brass Tensioner Thumb Screw until it applies light pressure onto the welding wire. If this is too tight, it will deform the wire and cause feeding issues. If it is too loose, the drive roller will slip on the wire.
9. Remove the nozzle and contact tip.
10. Replace the wire spool cover.
11. Plug in welder to your power source and turn on the welder.
12. Trigger the Spool Gun to feed the wire and adjust the Brass Tensioner Thumb Screw so that the wire does not slip.
13. Replace Contact Tip and Nozzle.

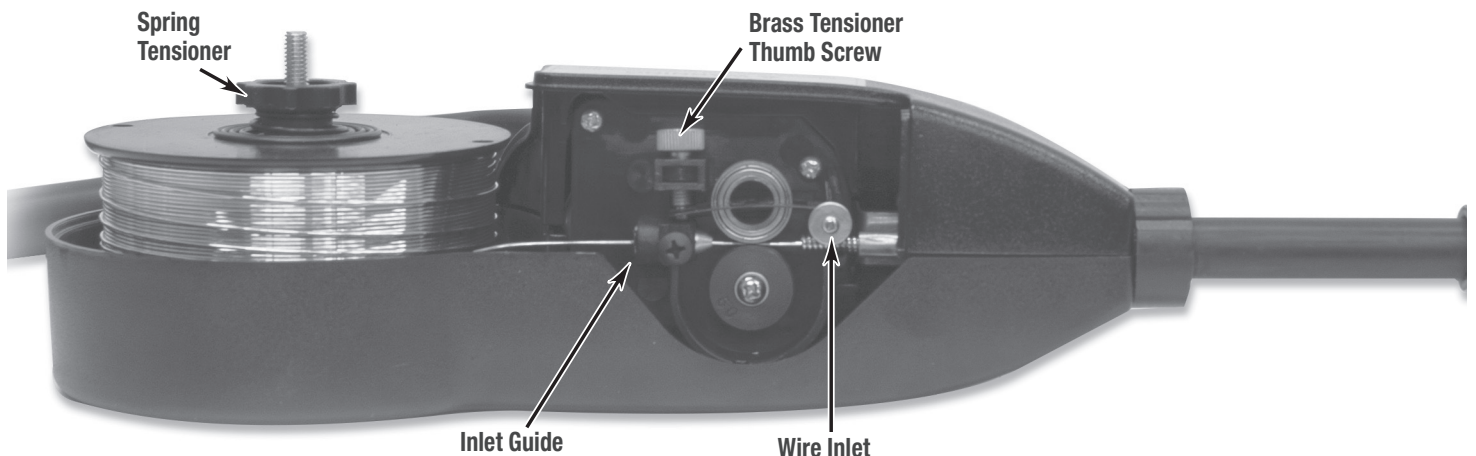

DUTY CYCLE

The rated Duty Cycle refers to the amount of welding that can be done within an amount of time. It is easiest to look at your welding time in blocks of 10 Minutes and the Duty Cycle being a percentage of that 10 Minutes. If welding at 250 Amps with a 60% Duty Cycle, within a 10 Minute block of time you can weld for 6 Minutes with 4 Minutes of cooling for the welder. If the duty cycle is exceeded and the breaker is tripped, allow the unit to cool for a minimum of 15 Minutes. To increase the Duty Cycle, you can turn down the Voltage Output control.

MIG WELDING OPERATION

Your Eastwood MIG 250 can be used to form a large number of different joints and welds all of which will require practice and testing before using on an actual project piece. The following welding process is a baseline to help get you started:

1. Refer to the 'Suggested Settings' chart which is located inside the side door of your Eastwood MIG 250, as well as below in the instruction manual. From the chart select your baseline starting point for the recommended settings described in the chart.
2. Change the output polarity if necessary according to the welding wire's specifications. This welder comes set up to use solid MIG wire, but if using Flux-cored wire, the polarity will need to be changed.
3. Connect your ground clamp to the work pieces that are to be welded. Make sure the ground clamp contacts are placed on a clean piece of metal free of paint, grease, rust, oils, etc. It is recommended to place your ground clamp as close to the weld area as possible.
4. Assess your weld area and make sure the welding area is also cleaned of any paint, grease, rust, oils, etc.
5. Plug in the welder and switch to the 'ON' position.
6. Open your gas valve on the bottle and adjust the flow rate if necessary.
7. Depress the torch trigger pointing the welding gun away from your body and then let go of the trigger and cut the wire back to ~1/4" stick out length.
8. Wearing your welding helmet, gloves and long sleeve shirt and pants, put the end of the wire sticking out of the gun into the joint to be welded.
9. Position the welding gun so that it is perpendicular to the base metal with ~20° tilt back.
10. Depress the trigger to start the wire feed which starts the arc. **NOTE:** A push, perpendicular or drag technique can be used to weld the pieces together; the type used depends on the type of joint as well as other influential conditions.
11. Once you depress the trigger and the arc has started, you will notice a molten puddle will form; this puddle is the weld bead and will follow the motion of the welding torch. Watching the size of the puddle dictates how fast you should be moving with the torch. If you burn through the material, you are either moving too slow or you need to make some adjustments to the welder settings. If you're not penetrating the base metal, you're either moving too fast or you need to make adjustments to the welder settings.
12. Release the trigger on the welding gun to stop the weld.
13. After finished welding, close the valve completely on the Shielding Gas Bottle.

SPOOL GUN WELDING OPERATION

Your Eastwood MIG 250 can be used to weld aluminum utilizing a spool gun, which can be purchased from Eastwood. To utilize the Spool Gun, you will also need to purchase a cylinder of 100% Argon gas from your local welding supplier. The following welding process is a baseline to help you get you started:

1. Refer to the 'Suggested Settings' chart which is located inside the side door of your welder. Select your baseline starting point for the recommended settings described in the chart.
2. Ensure that the polarity is configured for DCEP welding.
3. Set the process selector switch to 'MIG'.
4. Set the MIG/Spool Gun Selector Switch to 'Spool Gun'.
5. Connect your ground clamp to the work pieces that are to be welded. Make sure the ground clamp contacts are placed on a clean piece of metal free of paint, grease, rust, oils, etc. It is recommended to place your ground clamp as close to the weld area as possible.
6. Assess your weld area and make sure the welding area is also cleaned of any paint, grease, rust, oils, etc. Aluminum has a layer of oxide on the surface that should be removed prior to welding.
7. Plug in the welder and switch to the 'ON' position.
8. Open your gas valve on the bottle and adjust the flow rate if necessary.
9. Depress the spool gun trigger for a few seconds pointing the welding gun away from your body and then let go of the trigger and cut the wire back to ~3/4" stick out length.
10. Wearing your welding helmet, gloves and long sleeve shirt and pants, put the end of the wire sticking out of the spool gun into the joint to be welded.
11. Position the welding gun so that it is perpendicular to the base metal with 10-15° angle in the direction of push travel.
12. Depress the trigger to start the wire feed which starts the arc. **NOTE:** When welding aluminum with a Spool Gun, it is recommended to use a push technique. Using a drag technique will result in poor, dirty welds.
13. When welding aluminum a spray arc transfer is preferred rather than short arc transfer that can be more commonly used on steels. This method involves using a longer wire stick out (~3/4"). When the welder settings and technique have been dialed in, the spray arc transfer should create a hissing sound and little or no spatter. Once positioned, the trigger can be pulled and the weld started.
14. Release the trigger on the welding gun to stop the weld.
15. After finished welding, close the valve completely on the Shielding Gas Bottle.

TROUBLESHOOTING TABLE



See page 15 for test points and values.

See page 16 for parts location.

SYMPTOM	POTENTIAL PROBLEM	DIAGNOSTIC TEST	SOLUTION
Nothing happens when power switched on	No or low A/C Voltage Source	Check A/C Voltage at Wall Outlet (120 or 240V AC)	Circuit breaker or wall circuit
	Loose or open connections at Power Switch	Visual and continuity test at switch connection	Repair loose/open connection
	Faulty Power Switch	Verify power switch function	Replace faulty power switch
	Faulty Overload Switch	Reset Overload Switch, faulty if trips again immediately	Replace faulty Overload Switch
	Faulty Board PZ01-025	Check for 310V DC across pins 1 and 9 on CN@ and pins 1 and 2 on CN14 on board PZ01-025	If 0V DC on either connector, Replace Board PZ01-025
	Faulty Board PK01-056		If 310V DC, Replace Board PK01-056
Unit powers up but fan not running	Open or Loose connection in Fan Circuit	Visual/Continuity Check of Fan Connections	Repair loose/open in Fan circuit
	Faulty Fan	Check for 24V DC at CN12 on PZ01-025	If 24V DC, Replace Fan
	Faulty PK01-056		If 0V DC, Replace Board PZ01-025
Unit Immediately Trips Breaker and/or Overload Light is ON	Internal Wiring Short Circuit	Inspect Power Circuit inside Unit for Short Circuit	Repair Internal Wiring or Replace Board PZ01-025 if Connector Damaged
	Short Circuit on Board PZ01-025	Inspect Board PZ01-025 for Short/Damage	Replace Board PZ01-025
	Short Circuit on PM01-002	Inspect PM01-002 for Signs of Damage	Replace Board PM01-002
Unit Powers up properly but nothing happens when Torch Trigger is pulled	Loose or Open Connection in Gun Trigger Circuit	Visual and continuity check of trigger wiring and connections	Repair loose/open connection
	Faulty Gun Trigger	Measure resistance across trigger terminals an MIG Gun when trigger pulled (should = 0 ohms)	Replace Torch if resistance does not = 0 Ohms when Trigger Pulled
	Faulty board PHB-10	Short circuit terminals 3 and 4 at connector X10 on PK01-056	If unit responds, replace board PHB-10
	Faulty board PK01-056	Short circuit terminals 3 and 4 at Connector X10 on PK01-056	If still no response from unit, replace board PK01-056
	Wire feed mode not selected	Check position of Wire Feed Selector on Front Panel	Press button to select Torch mode

TROUBLESHOOTING TABLE



See page 15 for test points and values.

See page 16 for parts location.

SYMPTOM	POTENTIAL PROBLEM	DIAGNOSTIC TEST	SOLUTION
Unit Powers up normally but No or Erratic Wire Feed when Trigger is Pulled	Wire Feed mode not selected	Check position of spool run transfer switch	Move switch to wire feed mode
	Wire Feed set too slow	Check wire feed setting on front panel	Adjust wire speed if needed
	Gun Cable damaged or bent	Visual check of Cable	Straighten or replace Cable
	Contact Tip blocked	Visual check of Tip	Clear blockage or replace Contact Tip
	Incorrect Inlet Guide or Contact Tip	Confirm correct consumables for wire size	Replace with correct size consumables if needed
	Hub tension too high	Check wire Hub tension	Adjust tension as needed
	Drive Roller pressure too low	Check Drive Roller pressure	Adjust Drive Roller pressure as needed
	Incorrect Drive Roller	Confirm correct drive roller for wire size	Replace with correct drive roller if needed
	Damaged Wire Speed Potentiometer	Check function of potentiometer, 0 to 10 kOhm	Replace potentiometer if required
	Faulty Board PK01-056	Press Quick Feed button. Measure voltage across pins 1 and 4 on X6 on Board PK01-056	If 20V DC replace drive motor. If 0V DC replace Board PK01-056
Unit Powers up normally but no gas flow when trigger is pulled. Audible click of solenoid can be heard.	Gas bottle closed or empty	Check bottle fill and make sure valve is open	Fill gas bottle or open valve
	Gas flow restriction	Check gas lines and connections for blockage or loose connections (including torch)	Re-attach, repair, or replace gas lines as needed
Unit Powers up normally but no gas flow when trigger is pulled. No audible click of solenoid can be heard.	Open or loose wiring in Gas Solenoid Circuit	Visual and continuity check of gas solenoid wiring	Repair loose/open in Gas Solenoid Circuit
	Faulty Gas solenoid	Check for 24V DC at X16 on board PK01-056 with Gun Trigger Pulled	If voltage = 24V DC, replace Gas Solenoid
	Faulty Board PK01-056		If no voltage, replace Board PK01-056

TROUBLESHOOTING TABLE




See page 15 for test points and values.

See page 16 for parts location.


SYMPTOM	POTENTIAL PROBLEM	DIAGNOSTIC TEST	SOLUTION
Unit Powers up normally but Low or No Weld Output	Low Input Line Voltage	Check AC Voltage at Wall Outlet (120/240V AC)	Repair cause of low line voltage
	Poor Ground Connection	Check quality of Ground Connection	Ensure good metal to metal ground contact
	Loose or Open Connection in Ground Circuit	Ground Cable for Loose Connections	Repair or replace ground cable
	Poor Weld Surface Condition	Check condition of welding surface for dirt, oil, paint, rust, etc.	Clean surface with appropriate cleaner and /or wire brush
	Worn Contact Tip	Choose condition of Contact Tip	Replace Contact Tip
	Damaged Torch	Check condition of torch weld cable for damage	Replace Torch
	Damaged Arc Volt Potentiometer	Check function of potentiometer, 0 to 1 kOhms	Replace potentiometer if required
	Faulty Board PZ01-025	Check for 310V DC across pins 1 and 9 on CN2 and pins 1 and 2 on CN14 on board PZ01-025	If 0V DC on either connector, Replace Board PZ01-025
	Damaged Wire Speed Potentiometer		If 310V DC, Replace Board PK01-056

CIRCUIT DIAGRAMS WITH TEST VALUES

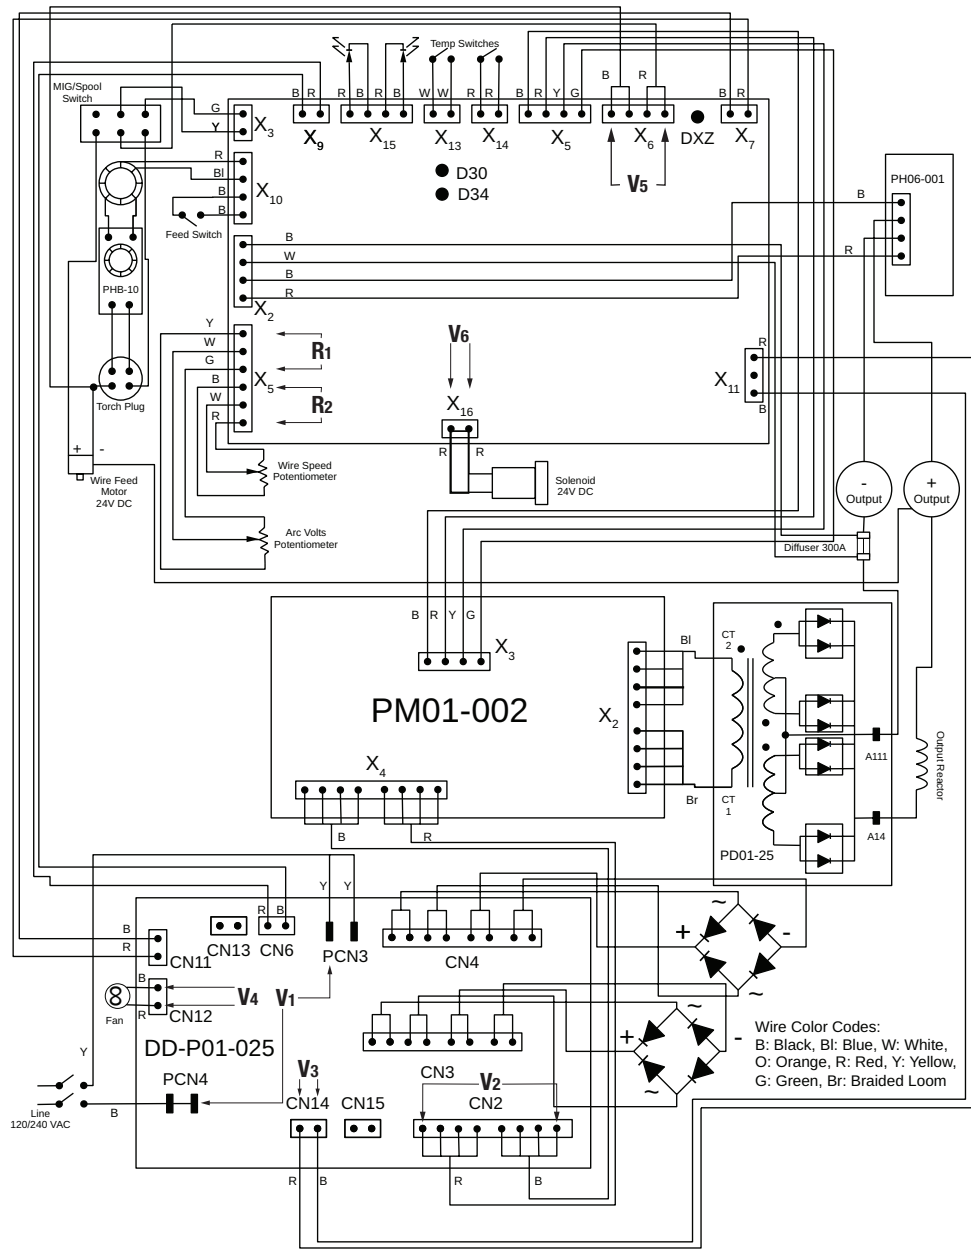

VOLTAGE READINGS	
V1	120 or 240V AC with power switch ON, input voltage
V2	310V AC
V3	310V AC
V4	24V DC, fan voltage
V5	20 to 24V DC, drive motor voltage
V6	24V DC, solenoid voltage
R1	1 kOhm, arc volt potentiometer
R2	10 kOhm, wire speed potentiometer

EXPLODED VIEW WITH PARTS LIST

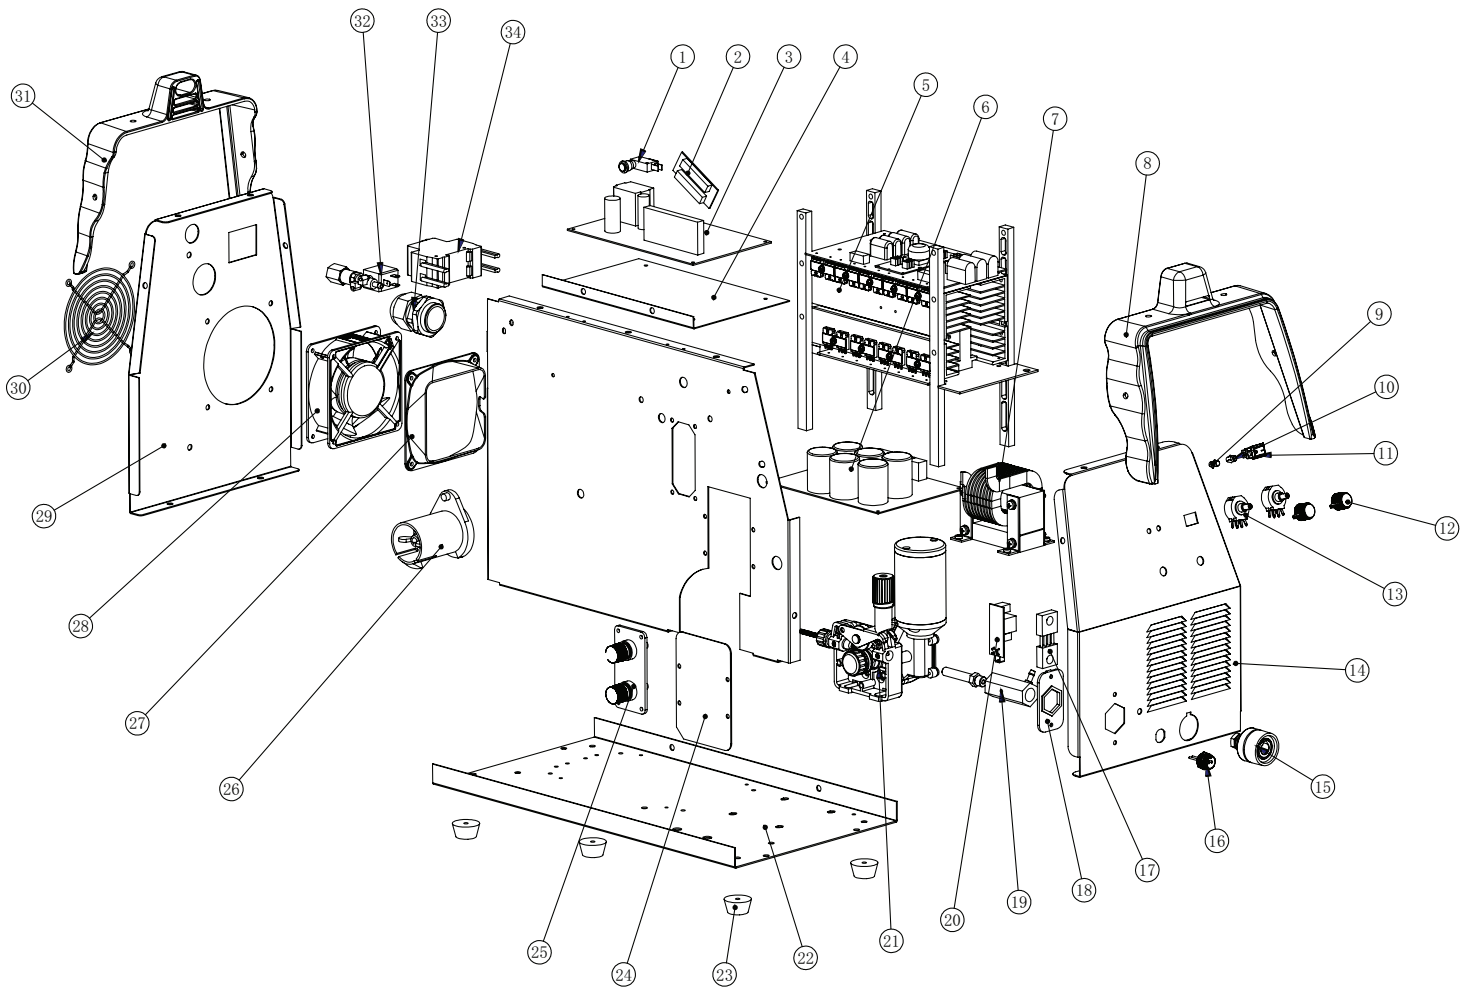

REF #	ITEM #	DESCRIPTION
1	22542	Quick Feed Switch
2	N/A	Absorption Board
3	22539	Main Control Board, PK01-056
4	N/A	Main Control Board Support
5	22541	Inverter Board, PM01-002
6	22540	Power Board, P01-025
7	N/A	Reactor
8	N/A	Front Plastic Bezel
9	N/A	Power Indicator Light
10	N/A	Overload Light
11	N/A	Rocker Switch
12	N/A	Knob
13	33112	Potentiometers, 2-piece Kit
14	N/A	Front Panel
15	N/A	Quick Connector
16	N/A	Aviation Socket
17	N/A	Diverter

REF #	ITEM #	DESCRIPTION
18	N/A	Torch Bracket
19	N/A	Torch Connector
20	N/A	Torch Switch Isolation Board
21	20574	Wire Feeder
22	N/A	Bottom Panel
23	N/A	Rubber Foot
24	N/A	Partition Panel
25	N/A	Terminal Mounting Board
26	N/A	Spool Adapter
27	N/A	Fan Shroud
28	33101	Fan
29	N/A	Back Panel
30	N/A	Fan Grill
31	N/A	Rear Plastic Bezel
32	20575	Solenoid
33	N/A	Strain Relief
34	33098	Circuit Breaker
Not Shown	20570	Torch
Not Shown	21324	Torch Liner
Not Shown	20571	Ground Cable
Not Shown	20325	Drive Roller 0.9/1.2
Not Shown	20319	Drive Roller 0.6/0.8
Not Shown	22543	Gas Hose
Not Shown	20572	Torch Nozzle
Not Shown	21831	Torch Nozzle, 2-pack
Not Shown	20427	Spot Weld Nozzle, 2-pack
Not Shown	21834	Contact Tip, 0.045, 5-pack
Not Shown	21833	Contact Tip, 0.035, 5-pack
Not Shown	21832	Contact Tip, 0.030, 5-pack
Not Shown	20573	Gas Diffuser

If you have any questions about the use of this product, please contact

The Eastwood Technical Assistance Service Department: 800.343.9353 >> email: tech@eastwood.com

PDF version of this manual is available at eastwood.com

The Eastwood Company 263 Shoemaker Road, Pottstown, PA 19464, USA 800.343.9353 eastwood.com

© Copyright 2020 Eastwood Automotive Group LLC 11/20 Repair Manual #20279RM Rev 1